


Operator's Manual

CRAFTSMAN[®]

15"
3 Speed
BAND SAW

Model No.
351.243971

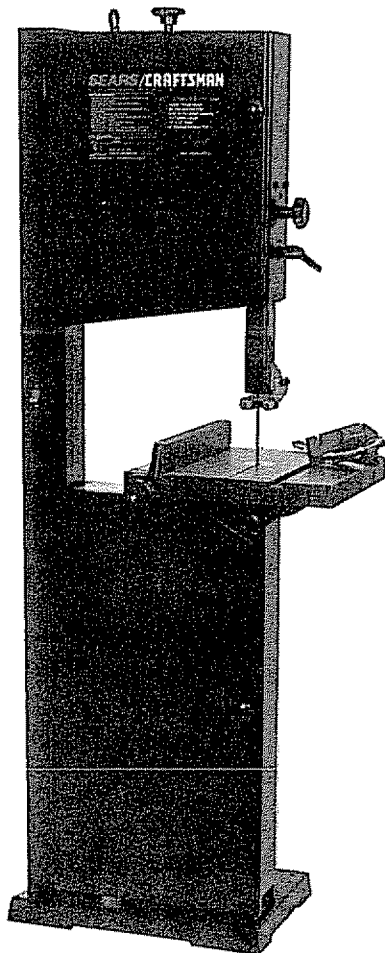

CAUTION: Read and follow all Safety Rules and Operating Instructions before First Use of this Product.

Sears, Roebuck and Co., Hoffman Estates, IL 60179 U.S.A.

8659.01 Draft (03/31/97)

SAFETY

ASSEMBLY

OPERATION

MAINTENANCE

PARTS LIST

TABLE OF CONTENTS

Warranty	2
Safety Rules	2-3
Unpacking	3
Assembly	3-5
Installation	5-6
Operation	6-9
Maintenance	9
Troubleshooting	10
Parts Illustration and List for Motor	12-13
Parts Illustration and List for Front	14-15
Parts Illustration and List for Blade Guides	16-17
Parts Illustration and List for Table	18-19
Parts Illustration and List for Gear Box	20-21

WARRANTY

FULL ONE YEAR WARRANTY ON CRAFTSMAN BAND SAW

If within one full year from the date of purchase, this Craftsman Band Saw fails due to a defect in material or workmanship, Sears will repair it free of charge.

Warranty service is available by contacting Sears in-home major brand repair service. This warranty gives you specific legal rights and you may also have other rights which vary from state to state.

If this Band Saw is used for commercial purposes, this warranty applies for only 90 days.

Sears, Roebuck and Co., Dept. 817 WA, Hoffman Estates, IL 60179

SAFETY RULES

WARNING: For your own safety, read all of the instructions and precautions before operating tool.

CAUTION: Always follow proper operating procedures as defined in this manual — even if you are familiar with use of this or similar tools. Remember that being careless for even a fraction of a second can result in severe personal injury.

BE PREPARED FOR JOB

- Wear proper apparel. Do not wear loose clothing, gloves, neckties, rings, bracelets or other jewelry which may get caught in moving parts of machine.
- Wear protective hair covering to contain long hair.
- Wear safety shoes with non-slip soles.
- Wear safety glasses complying with United States ANSI Z87.1. Everyday glasses have only impact resistant lenses. They are **NOT** safety glasses.
- Wear face mask or dust mask if operation is dusty.
- Be alert and think clearly. Never operate power tools when tired, intoxicated or when taking medications that cause drowsiness.

PREPARE WORK AREA FOR JOB

- Keep work area clean. Cluttered work areas invite accidents.
- Do not use power tools in dangerous environments. Do not use power tools in damp or wet locations. Do not expose power tools to rain.
- Work area should be properly lighted.
- Proper electrical receptacle should be available for tool. Three-prong plug should be plugged directly into properly grounded, three-prong receptacle.
- Extension cords should have a grounding prong and the three wires of the extension cord should be of the correct gauge.
- Keep visitors at a safe distance from work area.
- Keep children out of workplace. Make workshop childproof. Use padlocks, master switches or remove switch keys to prevent any unintentional use of power tools.

TOOL SHOULD BE MAINTAINED

- Always unplug tool prior to inspection.
- Consult manual for specific maintaining and adjusting procedures.
- Keep tool lubricated and clean for safest operation.
- Remove adjusting tools. Form habit of checking to see that adjusting tools are removed before switching machine on.
- Keep all parts in working order. Check to determine that the guard or other parts will operate properly and perform their intended function.
- Check for damaged parts. Check for alignment of moving parts, binding, breakage, mounting and any other condition that may affect a tool's operation.
- A guard or other part that is damaged should be properly repaired or replaced. Do not perform makeshift repairs. (Use parts list provided to order replacement parts.)

KNOW HOW TO USE TOOL

- Use right tool for job. Do not force tool or attachment to do a job for which it was not designed.
- Disconnect tool when changing blade.
- Avoid accidental start-up. Make sure that the tool is in the "off" position before plugging in.
- Do not force tool. It will work most efficiently at the rate for which it was designed.
- Keep hands away from moving parts and cutting surfaces.
- Never leave tool running unattended. Turn the power off and do not leave tool until it comes to a complete stop.
- Do not overreach. Keep proper footing and balance.
- Never stand on tool. Serious injury could occur if tool is tipped or if blade is unintentionally contacted.

- Know your tool. Learn the tool's operation, application and specific limitations.
- Use recommended accessories (refer to page 15) Use of improper accessories may cause risk of injury to persons.
- Handle workpiece correctly. Protect hands from possible injury.
- Turn machine off if it jams. Blade jams when it digs too deeply into workpiece. (Motor force keeps it stuck in the work.) Do not remove summed or cut off pieces until the saw is turned off, unplugged and the blade has stopped.

WARNING: The operation of any power tool can result in foreign objects being thrown into the eyes, which can result in severe eye damage. Always wear safety goggles complying with United States ANSI Z87.1 (shown on package) before commencing power tool operation. Safety goggles are available through your Sears catalog.

UNPACKING

Refer to Figure 1.

Check for shipping damage. If damage has occurred, a claim must be filed with carrier. Check for completeness. Immediately report missing parts to dealer.

The band saw comes assembled as one unit. Additional parts which need to be fastened to the saw should be located and accounted for before assembling:

- A Table stud
- B V-belt
- C Motor pulley with set screw
- D Flat washer, (3)
- E Table with back trunnion attached
- F Trunnion rod with acorn nut
- G Knob, internal threads
- H Knob, external threads
- I Rip fence with knob
- J Miter gauge assembly
- K Table insert
- L Front trunnion with bolts and lock washers

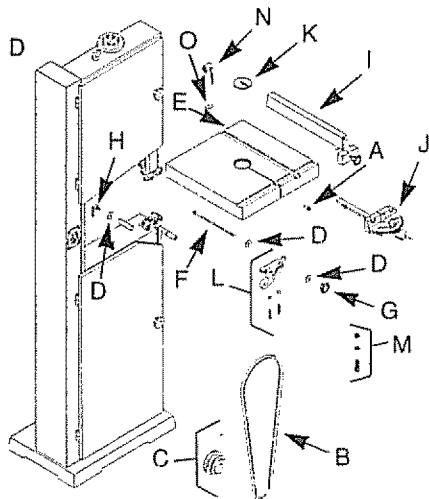


Figure 1 — Unpacking

M Motor mounting hardware

N Knob, internal threads

Not shown: Motor wiring bag: strain relief, serrated washer and wire nuts

IMPORTANT: Table is coated with a protectant. To ensure proper fit and operation, remove coating. Coating is easily removed with mild solvents, such as mineral spirits, and a soft cloth. Avoid getting solution on paint or any of the rubber or plastic parts. Solvents may deteriorate these finishes. Use soap and water on paint, plastic or rubber components. After cleaning, cover all exposed surfaces with a light coating of oil. Paste wax is recommended for table top.

WARNING: Never use highly volatile solvents. Non flammable solvents are recommended to avoid possible fire hazard.

ASSEMBLY

Refer to Figure 5, 6, 8, 9 and 10.

CAUTION: Do not attempt assembly if parts are missing. Use operator's manual to order replacement parts.

ATTACH TABLE

Refer to Figure 9.

- Table (Key No. 1) is attached to frame with two cast iron trunnions.
- Finger tighten one 1 socket head bolt with washer (Key Nos. 3 and 4) on left side of front trunnion (Key no. 2) into table.
- Bring table to frame by inserting back of blade into slot. Position table with back trunnion (Key No. 5) on guide posts which are welded to frame.
- Position front trunnion so it rides on guide post. Attach externally threaded knob with flat washer (Key Nos. 12 and 11) to secure back trunnion.
- Insert trunnion rod with acorn nut and flat washer (Key Nos. 10 and 11) through other guide post and attach the internally threaded knob with flat washer (Key Nos. 12 and 11) to the trunnion rod.
- Mount second bolt with washer on front trunnion. Position front trunnion flat against bottom of table and tighten internally threaded knob to secure.
- Tighten socket bolts (Key No. 3) to secure trunnions to table. Install table stud (Key No. 16).

SET HORIZONTAL STOP

Refer to Figure 9.

- When table is attached to frame, a bolt (Key No. 14) is used for a horizontal stop.
- Loosen trunnion knobs and set table at 90° to blade using a square
- Secure position of table with knobs.
- Adjust bolt to contact bottom edge of table.
- Lock bolt in position with hex nut (Key No. 15)

ATTACH RIP FENCE

Refer to Figure 9.

- Rip fence (Key No. 19) rides in the slot of table (Key No. 1).
- Slide rip fence into slot.
- Hold rip fence to table and fasten by threading knob (Key No. 20) into rip fence.
- Rip fence can be repositioned by loosening knob.

ATTACH GUIDE LOCKING KNOB

Refer to Figure 8.

- Slide $\frac{5}{16}$ " flat washer (Key No. 37) on hex head bolt (Key No. 32).
- Tighten knob (Key No. 30) on to hex head bolt.

ALIGN TABLE

Refer to Figure 9.

- The table must be aligned properly so that the blade is at a right angle to the table and that the rip fence is aligned with the blade.
- Lock the table in the horizontal position. Mount the rip fence on the table. Slide the rip fence next to, but not touching, the blade. Lock the rip fence.
- Check that the blade is aligned parallel with the rip fence. If the blade and fence are not parallel, loosen knobs (Key Nos. 12 and 13) on the trunnions (Key Nos. 2 and 5). Adjust the table position so that the blade and rip fence are parallel. Secure the table position by tightening the knobs.
- After assembly, the table has to be aligned in order to have the blade running through the center of the slot in the table insert.
- To move table sideways, loosen the four socket head bolts (Key No. 3) that secure the trunnions to the table. Move table to left or right until blade runs through the center of slot. Tighten bolts and make sure that table stays in position while bolts are being tightened.

MOUNT MOTOR

Refer to Figure 6.

- Mount motor to motor mount plate (Key No. 9) using carriage bolts, lock washers, and hex nuts provided (Key Nos. 19, 21 and 22).
- Finger tighten hex nuts. Motor will need to be repositioned to obtain proper V-belt tension.

WIRE MOTOR

Refer to Figures 2 and 6.

The motor should be wired for 115 volts and counter-clockwise rotation as viewed from shaft end of motor. A schematic supplied with motor will describe proper wiring procedures. Be sure to wire motor for counter-clockwise rotation facing shaft end.

Remove thin hex nut from strain relief. Insert strain relief into $\frac{3}{8}$ " knockout in shaft side of motor connection box. Secure with thin hex nut. Pass motor cord through

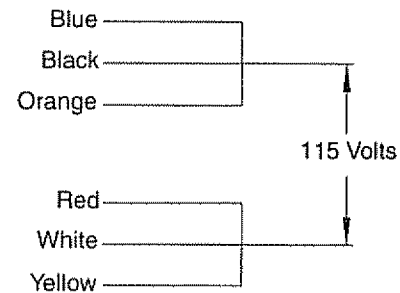


Figure 2 - Wiring Schematic

strain relief. Secure motor cord by tightening thick hex nut. Connect and insulate wires properly using wire nuts provided. Wire motor to motor cord using the schematic shown in Figure 2.

WARNING: All electrical connections must be performed by a qualified electrician.

GROUND MOTOR

Green wire of motor cord and serrated washer must be connected to motor body. Remove green grounding screw located in connection box of motor. Position green wire ring terminal onto grounding screw and serrated washer next to ring terminal. Secure serrated washer and green wire in motor cord to motor body.

NOTE: Be sure that the serrated washer is secured directly in contact with motor body.

INSTALL MOTOR PULLEY

Refer to Figure 10.

- Slide motor pulley (Key No. 26) onto motor shaft with key in motor shaft groove and motor pulley keyway.
- Use straightedge across outer surface of both motor and idler pulley (Key No. 23) to make sure motor pulley and idler pulley are parallel.
- If the motor pulley and idler pulley are not parallel, the band saw may develop excessive vibration. Reposition motor if necessary.
- When pulleys are aligned, secure the position of the motor pulley with set screw (Key No. 27).

INSTALL V-BELT

Refer to Figures 5, 6 and 10.

- Band saw uses a step-pulley drive system to provide a selection of blade speeds.
- Loosen hex head bolt and hex nut (Figure 6, Key Nos. 11 and 14). Place V-belt (Figure 9, Key No. 25) on idler pulley and motor pulley (Figure 9, Key Nos. 23 and 26) with V-belt in desired location on pulleys. (See Figure 5, Blade Speeds, page 8.)
- Do not over tighten V-belts. Excessive tension on V-belt will reduce life of belt. Belt is properly tensioned when light pressure applied to midpoint of the belt produces about $\frac{1}{2}$ " deflection.
- Tension V-belt by pushing down on motor mount plate and tightening hex head bolt and hex nut.

MOUNT SAW TO FLOOR

- If saw is not properly positioned on a flat surface, it may develop excessive vibration.
- Mount to a flat, level surface through holes on top of base.

INSTALLATION

Refer to Figures 3 and 4.

MOTOR

The 115 Volt AC motor has the following specifications:

Horsepower	3/4
Voltage	115
Amps	11.5
Hertz	60
Phase	Single
RPM	1725

POWER SOURCE

The motor is designed for operation on the voltage and frequency specified. Normal loads will be handled safely on voltages not more than 10% above or below the specified voltage.

Running the unit on voltages which are not within the range may cause overheating and motor burn-out. Heavy loads require that the voltage at motor terminals be no less than the voltage specified. Power supply to the motor is controlled by a double pole locking rocker switch. Remove the key to prevent unauthorized use.

GROUNDING INSTRUCTIONS

WARNING: Improper connection of equipment grounding conductor can result in the risk of electrical shock. Equipment should be grounded while in use to protect operator from electrical shock.

Check with a qualified electrician if grounding instructions are not understood or if in doubt as to whether the tool is properly grounded.

This tool is equipped with an approved 3 conductor cord rated at 150V and a three prong grounding type plug for your protection against shock hazards.

Grounding plug should be plugged directly into a properly installed and grounded 3-prong grounding-type receptacle, as shown (Figure 3).

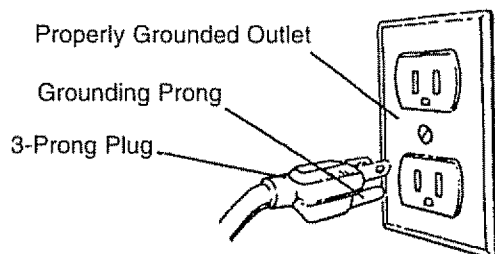


Figure 3 - 3-Prong Receptacle

Do not remove or alter grounding prong in any manner. In the event of a malfunction or breakdown, grounding

provides a path of least resistance for electrical shock.

WARNING: Do not permit fingers to touch the terminals of plug when installing or removing from outlet.

Plug must be plugged into matching outlet that is properly installed and grounded in accordance with all local codes and ordinances. Do not modify plug provided. If it will not fit in outlet, have proper outlet installed by a qualified electrician.

Inspect tool cords periodically, and if damaged, have them repaired by an authorized service facility.

Green (or green and yellow) conductor in cord is the grounding wire. If repair or replacement of the electric cord or plug is necessary, do not connect the green (or green and yellow) wire to a live terminal.

Where a 2-prong wall receptacle is encountered, it must be replaced with a properly grounded 3-prong receptacle installed in accordance with National Electric Code and local codes and ordinances.

WARNING: This work should be performed by a qualified electrician.

A temporary 3-prong to 2-prong grounding adapter (see Figure 4) is available for connecting plugs to a two pole outlet if it is properly grounded.

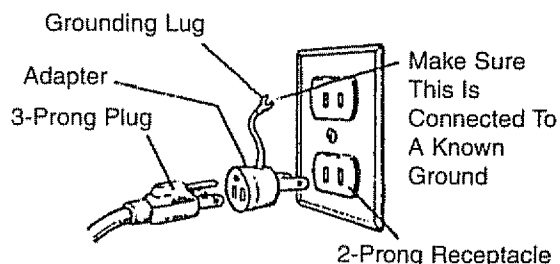


Figure 4 - 2-Prong Receptacle with Adapter

Do not use a 3-prong to 2-prong grounding adapter unless permitted by local and national codes and ordinances. (A 3-prong to 2-prong grounding adapter is not permitted in Canada.) Where permitted, the rigid green tab or terminal on the side of the adapter must be securely connected to a permanent electrical ground such as a properly grounded water pipe, a properly grounded outlet box or a properly grounded wire system. Many cover plate screws, water pipes and outlet boxes are not properly grounded. To ensure proper ground, grounding means must be tested by a qualified electrician.

EXTENSION CORDS

- The use of any extension cord will cause some drop in voltage and loss of power.
- Wires of the extension cord must be of sufficient size to carry the current and maintain adequate voltage.
- Use the table to determine the minimum wire size (A.W.G.) extension cord.

- Use only 3-wire extension cords having 3-prong grounding type plugs and 3-pole receptacles which accept the tool plug.
- If the extension cord is worn, cut or damaged in any way, replace it immediately.

EXTENSION CORD LENGTH

Wire Size	A.W.G.
Up to 50 ft.	16

NOTE: Using extension cords over 50 ft. long is not recommended.

OPERATION

Refer to Figures 5, 6, 7, 8, 9 and 10.

The 15", 3-speed vertical band saw for cutting ferrous and non-ferrous metals. The band saw features a unitized frame of welded steel construction and a solid cast iron work surface to ensure durability.

Table tilts to 45° and has a miter gauge and precision machined rip fence for performing many different operations. Fifteen inch balanced cast aluminum wheels with ball bearings and rubber treads accommodate blade widths up to 3/4".

A convenient tensioning and tracking mechanism assures that changing blades is not cumbersome. Saw can also accommodate blade widths up to 3/4" for many types of cuts.

SPECIFICATIONS

Depth of throat	14 5/8"
Maximum depth of cut.....	8 1/2"
Table size.....	15 x 15"
Table tilt	0 to 45°
Wheel diameter	15"
Blade length	111"
Blade width	3/16 to 3/4"
Blade speeds.....	80, 150 and 200 FPM
Overall dimensions	69 x 27 x 21"
Motor	Part No. 8377.00
.....	TEFC, 3/4 HP, 1725 RPM
Blades.....	No. 26660, 1/2" Carbon Blade, 14 TPI

CAUTION: Always observe the following safety precautions:

- Make sure that blade guides and thrust bearings are positioned and adjusted correctly to prevent side-ways and rearward movement of the blade. Adjust upper guide to just clear workpiece.
- Check to make sure blade is tensioned and tracking properly. Do not over tension the blade in order to prevent premature blade wear and breakage. Avoid under tensioning to eliminate back and forth, side to side blade movement as it cuts.

- Use proper blade and speed for the cutting operation.
- After turning saw on, allow blade to come to full speed before attempting any cutting operation.
- Support workpiece properly and use a smooth steady feed to guide work through the cut. Use push sticks or push blocks when required.
- Keep hands away and out of line with moving parts.
- Always wear eye protection.

REMOVING BLADE

Refer to Figures 7 and 9.

WARNING: Disconnect band saw from power source when changing or adjusting blades. Wear leather gloves when handling band saw blades. Never wear gloves when operating saw.

- Loosen hex nut (Figure 7, Key No. 30) and rotate handwheel (Figure 7, Key No. 23) to release blade tension. Be careful; blade may spring from saw when tension is released. Remove table stud (Figure 9, Key No. 16), take out the released blade and replace with another blade.

INSTALLING BLADE

- Although many of the adjustments may not be altered when blade is removed, every adjustment should be checked prior to using a newly installed blade.
- Follow safety precautions every time saw is operated.
- Make sure blade teeth are pointing down towards table. Turn blade inside out if necessary.
- Slip new blade into table slot and over upper and lower blade wheels and center blade on blade wheels. Slide blade in between blade guides. Replace table stud.
- Tension and track blade as described in the following sections.

TENSIONING BLADE

Refer to Figure 7.

- Tension blade by rotating handwheel (Key No. 23). Be sure blade guides do not interfere with blade path.
- Tighten blade until it is properly tensioned.
- A properly tensioned blade will ring slightly when back of blade is plucked (like a string on an instrument).

NOTE: Check tension of new blade. Additional tension may be required after a few minutes of operation.

TRACKING BLADE

Refer To Figure 7.

- Track blade after it has been tensioned. A change in blade tension will affect wheel alignment.
- Proper tracking is achieved when drive and idler wheels are aligned. Knob (Key No. 29) is used to tilt tracking bar (Key No. 13) and align blade wheels.
- Loosen nut (Key No. 30) which locks tracking knob (Key No. 29). Turn idler wheel (Key No. 7) by hand and observe how blade rides on wheels.

- If blade rides away from cabinet, turn knob clockwise to tilt idler wheel up.
- If blade rides into cabinet, turn tracking knob counterclockwise.
- When blade is tracking properly, lock position by holding knob and tightening nut (Key No. 30) against the cabinet.

ALIGNMENT OF DRIVE WHEEL

Refer to Figure 10.

NOTE: Only attempt adjusting drive wheel alignment if blade cannot be properly tracked with tracking adjustment alone.

- A blade under high tension may also pull drive wheel out of alignment.
- Adjust alignment of drive wheel with set screws and hex head bolts (Key Nos. 8 and 30).

BLADE GUIDES

NOTE: Adjust blade guides only after blade has been properly tensioned and tracked.

- Blade guides support blade at sides and rear of blade, and prevent twisting or deflection.
- Blade guides should not touch blade when no workpiece is in contact with blade. Adjust guides as described in following sections.

UPPER BLADE GUIDES

Refer to Figure 8.

- Upper blade guides employ guide pins for side support and a ball bearing on an adjusting pin at rear.
- Upper guide bracket (Key No. 13) should be positioned so guide on either side of blade will support as much of blade width as possible without interfering with the tooth set.
- Adjust bracket depth by loosening bolts (Key Nos. 9 and 12) and sliding brackets into position. Secure position of upper guide casting by tightening bolts.
- Loosen set screws (Key No. 15) and adjust guide pins (Key No. 14) to side of blade. Use a feeler gauge to check that guide pins are .002" away from blade.
- Lock adjustment by tightening set screws.
- Adjust thrust bearing (Key No. 17) at rear of blade by loosening set screw (Key No. 15).
- Position thrust bearing (Key No. 17) .002" away from back of blade.
- Secure position of thrust bearing by tightening set screw.
- Adjust the height of upper guide casting to clear the workpiece by ¼". Loosen knob (Key No. 30) and rotate height adjustment knob (Key No. 22) until upper blade guide bracket clears workpiece by ¼". Tighten knob (Key No. 30).

LOWER BLADE GUIDES

Refer to Figure 8.

- Lower blade guides employ two guide blocks for side support. Lower guide bracket is spaced close to table surface to minimize unsupported length of blade.
- Loosen bolt (Key No. 19) to position lower guide bracket on alignment block (Key No. 31). Adjust lower guide bracket so guide blocks do not interfere with blade set. Loosen set screws (Key No. 23) for guide blocks (Key Nos. 21 and 34) and adjust guide blocks to .002" from each side of blade.
- Adjust thrust bearing (Key No. 36) at rear of blade by loosening set screw (Key No. 23). Position thrust bearing .002" away from back of blade. Secure position of thrust bearing by tightening set screw.

BLADE SELECTION

- Blades vary depending on type of material, size of workpiece and type of cut that is being performed.
- Characteristics which make blades different are width, thickness and pitch.

BLADE WIDTH

- Width of blade describes distance from tip of a tooth to back of blade.
- Width of blade will affect rigidity of blade. A wider blade will wander less and produce a straighter cut.
- Width of blade also limits the smallest radius which can be cut. A ¼" wide blade can cut about a ½" radius.

BLADE THICKNESS

- Blade thickness describes the distance between sides of blade. A thicker blade has more rigidity and stronger teeth.
- A narrow thick blade would be used to cut curves while a wide thin blade would be used to make long, straight cuts.

BLADE PITCH

- Pitch describes number of teeth per inch or tooth size. A blade with more teeth per inch will produce a smoother cut.
- The type of material being cut determines number of teeth which should be in contact with work.
- For soft materials, the proper blade has between 4 and 8 teeth per inch.
- When cutting hard materials, where shocking is more detrimental, use a blade with 8 to 12 teeth per inch.
- There should always be at least three teeth in contact with cut to avoid shocking blade.
- Blade shocking occurs when pitch is too large and blade tooth encounters too much material. This can strip teeth from blade.
- Blade manufacturers are prepared to supply information about blades for specific applications.

BLADE SPEED

- The amount of force with which the blade cuts is determined by speed.
- High cutting speeds are used on soft materials where less force is needed and a high rate of material removal is desired.
- Low cutting speeds are used on hard materials when more force is required.
- To change blade speed, position V-belt in proper configuration (see Figure 5). Reposition and tension V-belt as described in the next section.

80 FPM	Steel and steel alloys
150 FPM	Cast iron and bronze
200 FPM	Aluminum, brass and copper

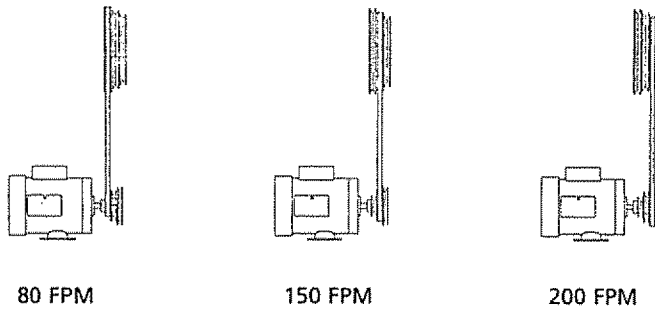


Figure 5 - Blade Speeds

REPOSITIONING V-BELT

Refer to Figures 5, 6 and 10.

- Blade speed is determined by the position of the V-belt on the idler and motor pulleys (Figure 10, Key Nos. 23 and 26). Blade speed is changed by changing pulley position of V-belt.
- Be sure to disconnect saw from power and turn saw OFF before attempting to change blade speed.
- To change blade speed loosen motor mount plate (Figure 6, Key No. 9) by loosening hex nut on hex head bolt (Figure 6, Key Nos. 14 and 11). Position V-belt on motor and idler pulleys as required. See Figure 5, Blade Speeds, for recommended pulley and belt settings.
- Tension V-belt by pushing down on motor mount plate and tightening nut on the hex head bolt. Be sure nut and bolt are tight. Belt is properly tensioned when light pressure applied to midpoint of the belt produces about 1/2" deflection. Do not over tighten V-belt.

TYPE OF CUT

- Rip fence guides workpiece to produce straight cuts on longer pieces.
- Contour cutting is done by guiding workpiece free-handed to produce curved shapes.
- Beveled cutting can be done by tilting table and using proper work guide method.
- Regardless of which work guiding method is used, a workpiece which overhangs table by more than 7"

should be properly supported by support stands. (See Recommended Accessories, page 15.)

RIP FENCE OPERATION

Refer to Figure 9.

- Rip fence can be used to guide boards with one square edge past blade when table is aligned properly.
- Set rip fence to desired width of cut on inside of throat. Remember to include the thickness of material that will be removed by blade.
- Use a square to measure from tip of a tooth to fence. Lock fence securely with knob (Key No. 20).
- The portion of material between blade and fence is considered the workpiece. Material on outside and behind cut is the scrap material which is being cut off. Use the right hand to keep work against fence.
- Do not push on scrap portion of the work. This could pinch or bind blade.
- Avoid passing hands beyond the cut. Use push sticks or push blocks to finish cuts and pass workpiece away from blade.

CONTOUR SAWING

- When contour sawing, use both hands to keep workpiece flat against table and guided along desired path.
- Avoid positioning hands in line with blade. If hands slip they could contact blade.
- Try to stand to front of the saw and use hands over the portion of table which is to right of blade and before cut.
- Cut small corners by sawing around them. Saw to remove scrap until desired shape is obtained.

BEVEL CUTTING

Refer to Figure 9.

- Perform a bevel operation by tilting table. Loosen knobs (Key Nos. 12 and 13) and tilt table to desired position.
- Use a square or protractor to set angle and lock table in position with knob. Use caution when supporting work while bevel cutting. Do not allow work to hang on blade.

MITER GAUGE

- Use miter gauge for securing and holding workpiece at desired angle to produce angled cuts. Use scale to adjust gauge to desired angle.
- Never use miter gauge and rip fence at the same time. The blade might bind in the workpiece. Operator could be injured and/or workpiece could be damaged.

BLADE CLEANING BRUSH

Refer to Figure 7.

- Make sure that brush (Key No. 36) is in contact with wheel to properly remove foreign particles from drive wheel.

MAINTENANCE

WARNING: Make certain that unit is disconnected from power source before attempting to service or remove any component.

CLEANING

- Keep machine and workshop clean. Do not allow sawdust to accumulate on band saw.
- Keep wheels clean. Debris on wheels will cause poor tracking and blade slippage.
- Keep mechanisms and threaded or sliding surfaces clean and free of foreign particles.
- Operate band saw with a dust collector to minimize clean up.

LUBRICATION

- The shielded ball bearings are permanently lubricated and require no further lubrication.
- Small amounts of machine oil can be applied to belt tension mechanisms and threaded or sliding surfaces.
- Occasionally apply a coat of automobile type wax to table top to keep it slick and corrosion free.

KEEP BAND SAW IN REPAIR


- If power cord is worn or cut in any way, have it replaced.
- Replace V-belt and blade when they are worn. Replace any damaged or missing part.
- Use parts list to order parts.

TROUBLESHOOTING

SYMPTOM	POSSIBLE CAUSE(S)	CORRECTIVE ACTION
Excessive blade breakage	<ol style="list-style-type: none"> 1. Material not secure on table 2. Incorrect speed or feed 3. Blade too coarse for material 4. Incorrect blade tension 5. Teeth in contact with work before sawing 6. Blade rubs on wheel flange 7. Misaligned guides 8. Blade too thick for wheel diameter 9. Cracking at weld 	<ol style="list-style-type: none"> 1. Squarely place work on table 2. Check Blade Speed (Figure 5, page 8) 3. Use finer pitch blade 4. Tension blade properly; see "Operation" 5. Place blade in contact with work after saw is started and has reached full speed 6. Adjust wheel alignment properly 7. Adjust blade guides properly 8. Use thinner blade 9. Replace blade
Premature blade dulling	<ol style="list-style-type: none"> 1. Blade too coarse 2. Excessive blade speed 3. Inadequate feed pressure 4. Hard spots or scale in or on material 5. Work hardening of workpiece 6. Blade installed backwards 7. Insufficient blade tension 	<ol style="list-style-type: none"> 1. Use finer tooth blade 2. Try lower speed 3. Gently increase pressure 4. Reduce speed; increase rate of feed for scale and change blades for hard spots 5. Increase rate of feed 6. Remove blade, twist inside out and reinstall blade 7. Tension blade properly; see "Operation"
Crooked cuts	<ol style="list-style-type: none"> 1. Work not square 2. Rate of feed too great 3. Blade guides not adjusted properly 4. Insufficient blade tension 5. Upper blade guide too far from workpiece 6. Dull blade 7. Incorrect speed 8. Blade guide assembly loose or blade thrust bearing loose 	<ol style="list-style-type: none"> 1. Use rip fence; adjust tilt of table at 90° to blade 2. Reduce rate of feed 3. Move both guide blocks within .002" from blade (use gauge) 4. Tension blade properly; see "Operation" 5. Adjust upper guide to just clear workpiece by ¼" 6. Replace blade 7. Check Blade Speed; see Figure 5, page 8 for recommended speeds 8. Tighten blade thrust bearing within .002" behind blade back
Rough cuts	<ol style="list-style-type: none"> 1. Too much speed or feed 2. Blade too coarse 	<ol style="list-style-type: none"> 1. Reduce speed or feed 2. Replace with finer blade
Blade is twisting or unusual wear on side/back of blade	<ol style="list-style-type: none"> 1. Cut is binding blade 2. Blade guides or bearing worn 3. Blade guides or bearings not adjusted properly 4. Blade guide brackets loose 	<ol style="list-style-type: none"> 1. Decrease feed pressure 2. Replace 3. Adjust blade guides; see "Operation" 4. Tighten properly
Teeth ripping from blade	<ol style="list-style-type: none"> 1. Teeth too coarse for work 2. Rate of feed too great 3. Vibrating workpiece 4. Teeth filling with material 	<ol style="list-style-type: none"> 1. Use blade with finer teeth 2. Decrease feed rate 3. Hold workpiece firmly 4. Use blade with coarser teeth
Motor running too hot	<ol style="list-style-type: none"> 1. Blade tension too great 2. Blade too coarse for work (typical when cutting pipe) 3. Blade too fine for work (typical when cutting slick or soft material) 4. Excessive dirt and chips 	<ol style="list-style-type: none"> 1. Reduce tension on blade 2. Use blade with finer teeth 3. Use blade with coarser teeth 4. Clean thoroughly; vacuum motor and speed change mechanism
Saw will not start	Loose electrical connections	Have qualified electrician check electrical connections

Model 351.243971

Figure 6 - Replacement Parts Illustration for Motor

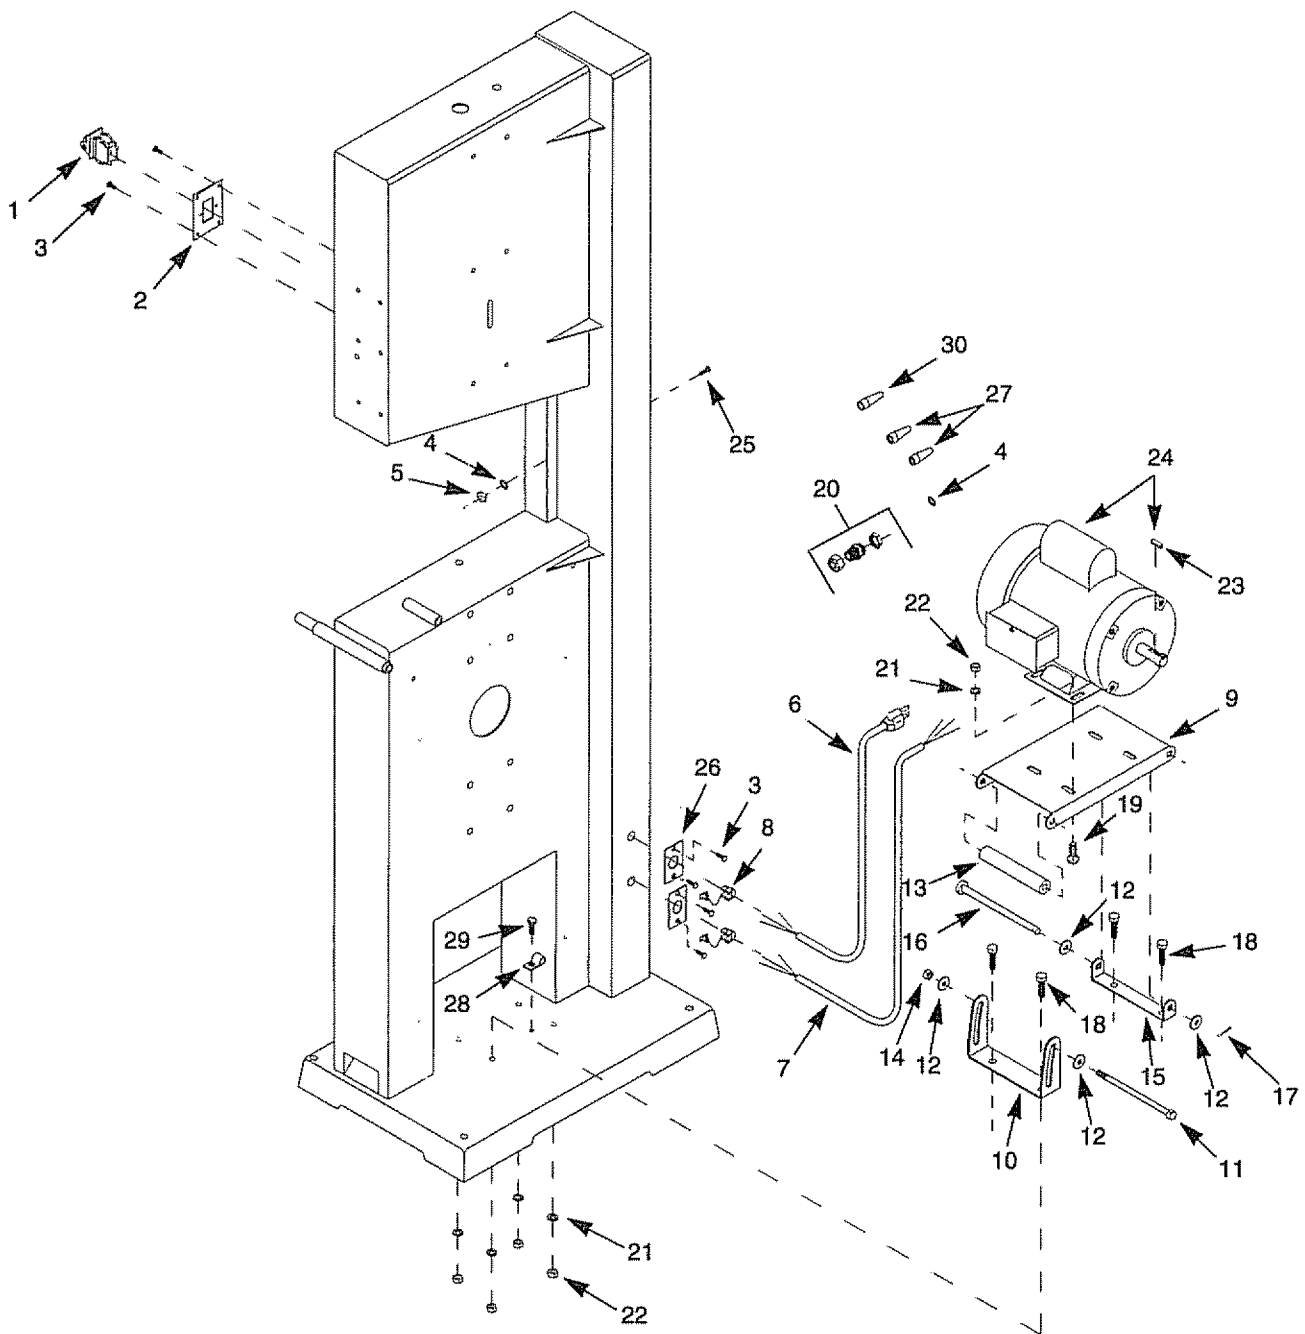


REPLACEMENT PARTS LIST FOR MOTOR

KEY NO.	PART NO.	DESCRIPTION	QTY.
1	0423.00	Switch	1
2	3668.00	Switch Plate	1
3	0361.00	5-0.8 x 8mm Pan Head Screw	8
4	46-58368-3	4mm Serrated Washer*	2
5	STD840407	4-0.7mm Hex Nut*	1
6	8292.00	Line Cord	1
7	8293.00	Motor Cord	1
8	0168.00	Strain Relief	2
9	8294.00	Motor Mount Plate	1
10	8295.01	Slide Bracket	1
11	8296.00	3/8"-16 x 6 1/2" Hex Head Bolt	1
12	STD551037	3/8" Flat Washer*	4
13	8297.00	Spacer	1
14	STD541037	3/8"-16 Hex Nut*	1
15	8299.00	Pivot Bracket	1
16	8300.00	Clevis Pin	1
17	STD561210	1/8 x 1" Cotter Pin*	1
18	STD835020	8-1.25 x 20mm Hex Head Bolt*	4
19	5188.00	8-1.25 x 20mm Carriage Bolt	4
20	7256.00	Strain Relief	1
21	STD852008	8mm Lock Washer*	8
22	STD840812	8-1.25mm Hex Nut*	8
23	0440.00	3/16 x 3/16 x 3/4" Key	1
24	8377.00	Motor With Key	1
25	8685.00	4-0.7 x 15mm Pan Head Screw	1
26	8172.01	Strain Relief Plate	2
27	5199.00	Wire Nut	2
28	0131.00	Cord Clamp	1
29	0853.00	5-0.8 x 15mm Pan Head Screw	1
30	5199.01	Wire Nut	1

* Standard hardware item available locally.

Model 351.243971

Figure 7 - Replacement Parts Illustration for Front

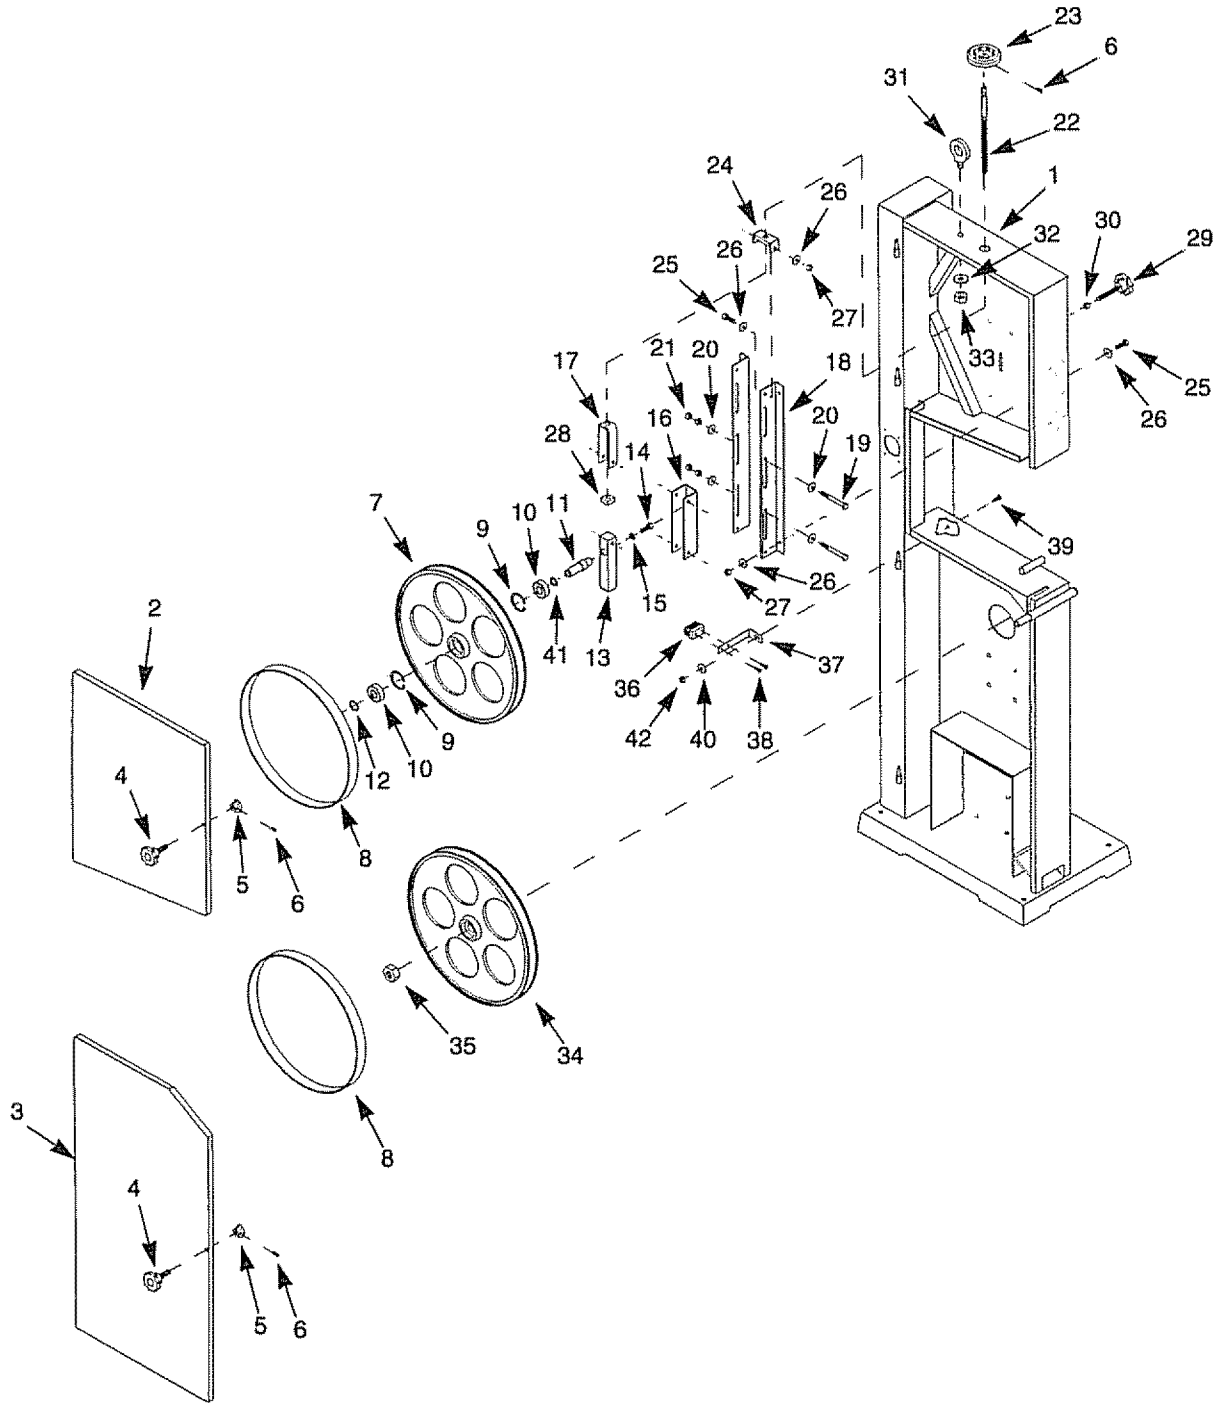

REPLACEMENT PARTS LIST FOR FRONT

KEY			
NO.	PART NO.	DESCRIPTION	QTY.
1	N/A	Frame	1
2	8302.00	Upper Cabinet Door	1
3	8303.00	Lower Cabinet Door	1
4	3663.00	Knob (External Threads)	2
5	8304.00	Latch	2
6	0964.00	6-1.0 x 6mm Set Screw	3
7	8305.00	Idler Wheel	1
8	8306.00	Rubber Tread	2
9	3838.00	3BMI-40 Retaining Ring	2
10	STD315238	6203LL Bearing*	2
11	6358.01	Idler Shaft	1
12	0341.00	3AMI-17 Retaining Ring	1
13	3605.01	Tracking Bar	1
14	STD835025	8-1.25 x 25mm Hex Hd. Bolt*	1
15	STD315235	8mm Lock Washer*	1
16	3608.00	Tracking Adjustment Bracket	1
17	3606.00	Tension Bracket	1
18	3609.00	Upper Cabinet Support	2
19	0836.00	8-1.25 x 70mm Hex Hd. Bolt	2
20	STD851008	8mm Flat Washer*	5
21	STD840812	8-1.25mm Hex Nut*	4
22	3612.01	Threaded Shaft	1

KEY			
NO.	PART NO.	DESCRIPTION	QTY.
23	5598.01	Handwheel	1
24	3610.00	Tension Support	1
25	STD833016	6-1.0 x 16mm Hex Hd. Bolt*	8
26	STD851006	6mm Flat Washer*	16
27	STD840610	6-1.0mm Hex Nut*	8
28	3607.00	Tension Nut	1
29	8307.00	Tracking Knob	1
30	STD541031	5/8"-18 Hex Nut*	1
31	8308.00	10-1.5mm Eye Bolt	1
32	STD851010	10mm Flat Washer*	1
33	STD841015	10-1.5mm Hex Nut*	1
34	8478.00	Drive Wheel	1
35	8310.00	20-1.5mm Hex Nut (Left Hand Thread)	1
36	3621.00	Brush	1
37	3620.00	Bracket	1
38	3619.00	#8-18 x 3/8" Thread Forming Screw	2
39	0853.00	5-0.8 x 15mm Pan Hd. Screw	1
40	STD851005	5mm Flat Washer*	1
41	8439.00	17mm Wavy Washer	1
42	STD840508	5-0.8mm Hex Nut*	1


Δ Not Shown

* Standard hardware item available locally.

Recommended Accessories		
Δ	Support Stand	921417
Δ	1/4" Carbon Blade, 14 TPI	926660

Model 351.243971

Figure 8 - Replacement Parts Illustration for Blade Guides

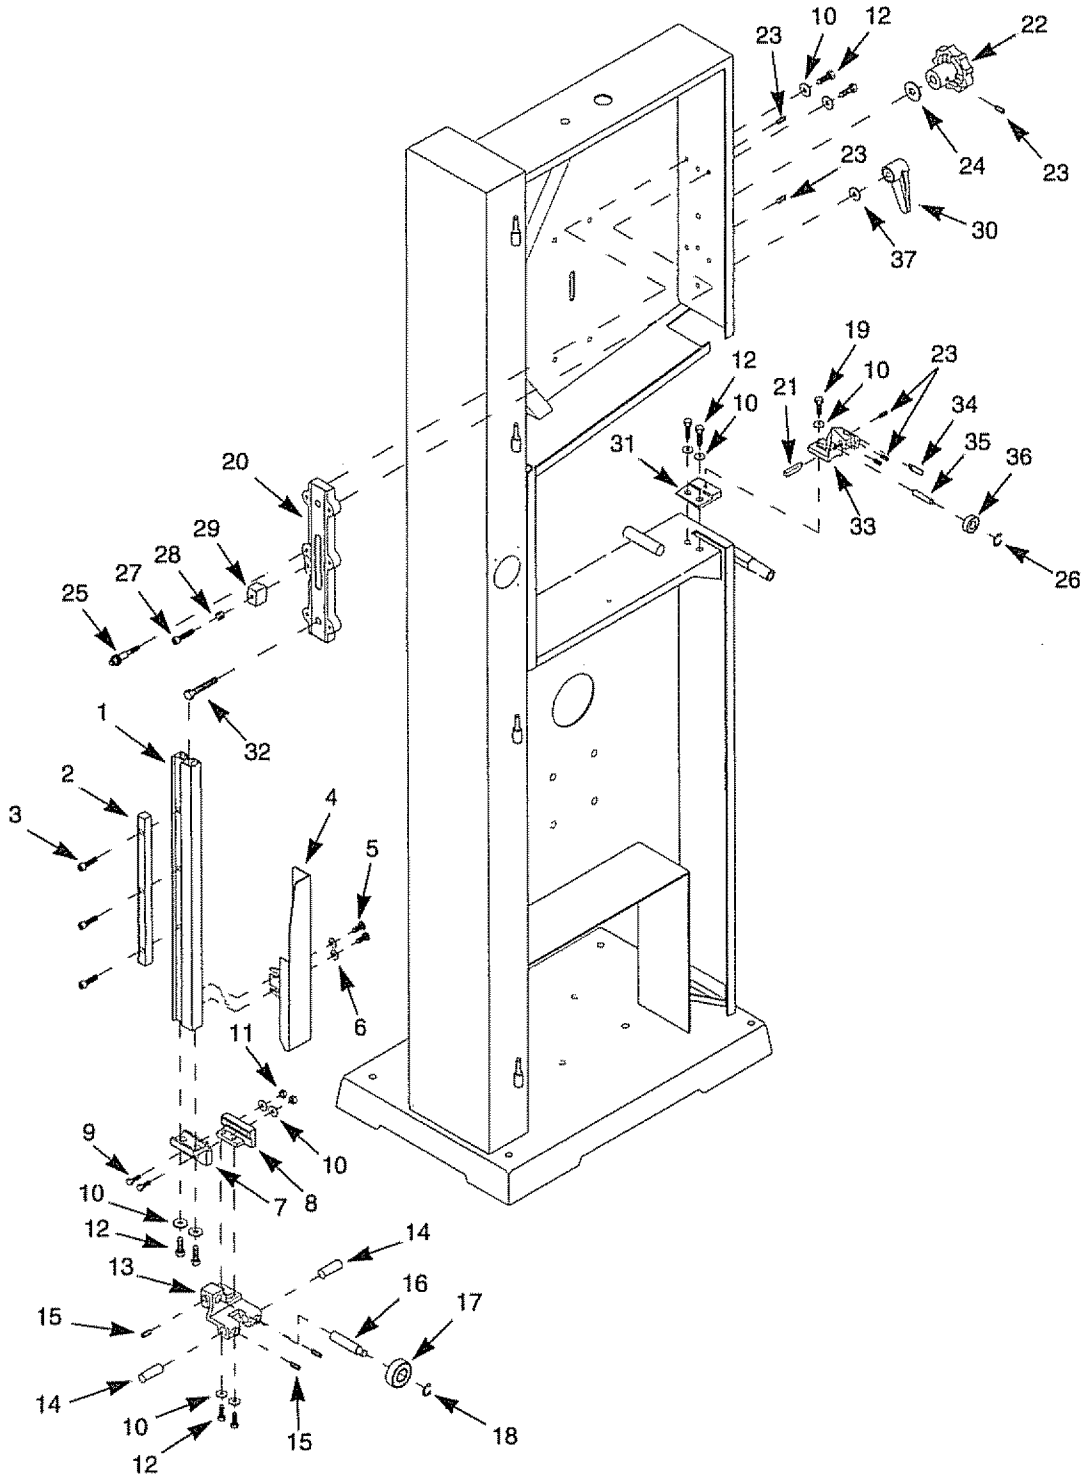


REPLACEMENT PARTS LIST FOR BLADE GUIDES

KEY NO.	PART NO.	DESCRIPTION	QTY.
1	8311.00	Guide Bar	1
2	8312.00	Rack	1
3	6045.00	5-0.8 x 20mm Socket Head Bolt	3
4	8313.01	Blade Guard	1
5	3619.01	Thread Forming Screw	2
6	STD851005	5mm Flat Washer*	2
7	8314.00	Guide Attaching Bracket	1
8	8607.00	Guide Depth Bracket	1
9	STD833025	6-1.0 x 25mm Hex Head Bolt*	2
10	STD851006	6mm Flat Washer*	13
11	STD840610	6-1.0mm Hex Nut*	2
12	STD833016	6-1.0 x 16mm Hex Head Bolt*	10
13	8316.00	Upper Guide Bracket	1
14	8317.00	Guide Pin	2
15	0958.00	8-1.25 x 8mm Set Screw	3
16	8318.00	Bearing Pin	1
17	STD315205	6200LL Bearing*	1
18	1434.00	3CMI-10 E-Ring	1
19	STD833012	6-1.0 x 12mm Hex Head Bolt*	1
20	8319.00	Guide Casting	1
21	8298.00	Guide Block	1
22	9582.00	Knob (Internal Threads)	1
23	0964.00	6-1.0 x 6mm Set Screw	6
24	STD851010	10mm Flat Washer*	1
25	8322.00	Pinion Shaft Assembly	1
26	8323.00	3CMI-8 E-Ring	1
27	1097.00	6-1.0 x 35mm Socket Head Bolt	1
28	9564.00	Spring	1
29	8324.00	Positioning Block	1
30	8352.00	Knob (Internal Threads)	1
31	6376.00	Alignment Block	1
32	8325.15	5/16-18 x 1 1/4" Hex Low Head Bolt	1
33	8353.00	Lower Guide Bracket	1
34	8354.00	Guide Block	1
35	8355.00	Bearing pin	1
36	STD315485	608LL Bearing*	1
37	STD551031	5/16" Flat Washer*	1

* Standard hardware item available locally.

Model 351.243971

Figure 9 - Replacement Parts Illustration for Table

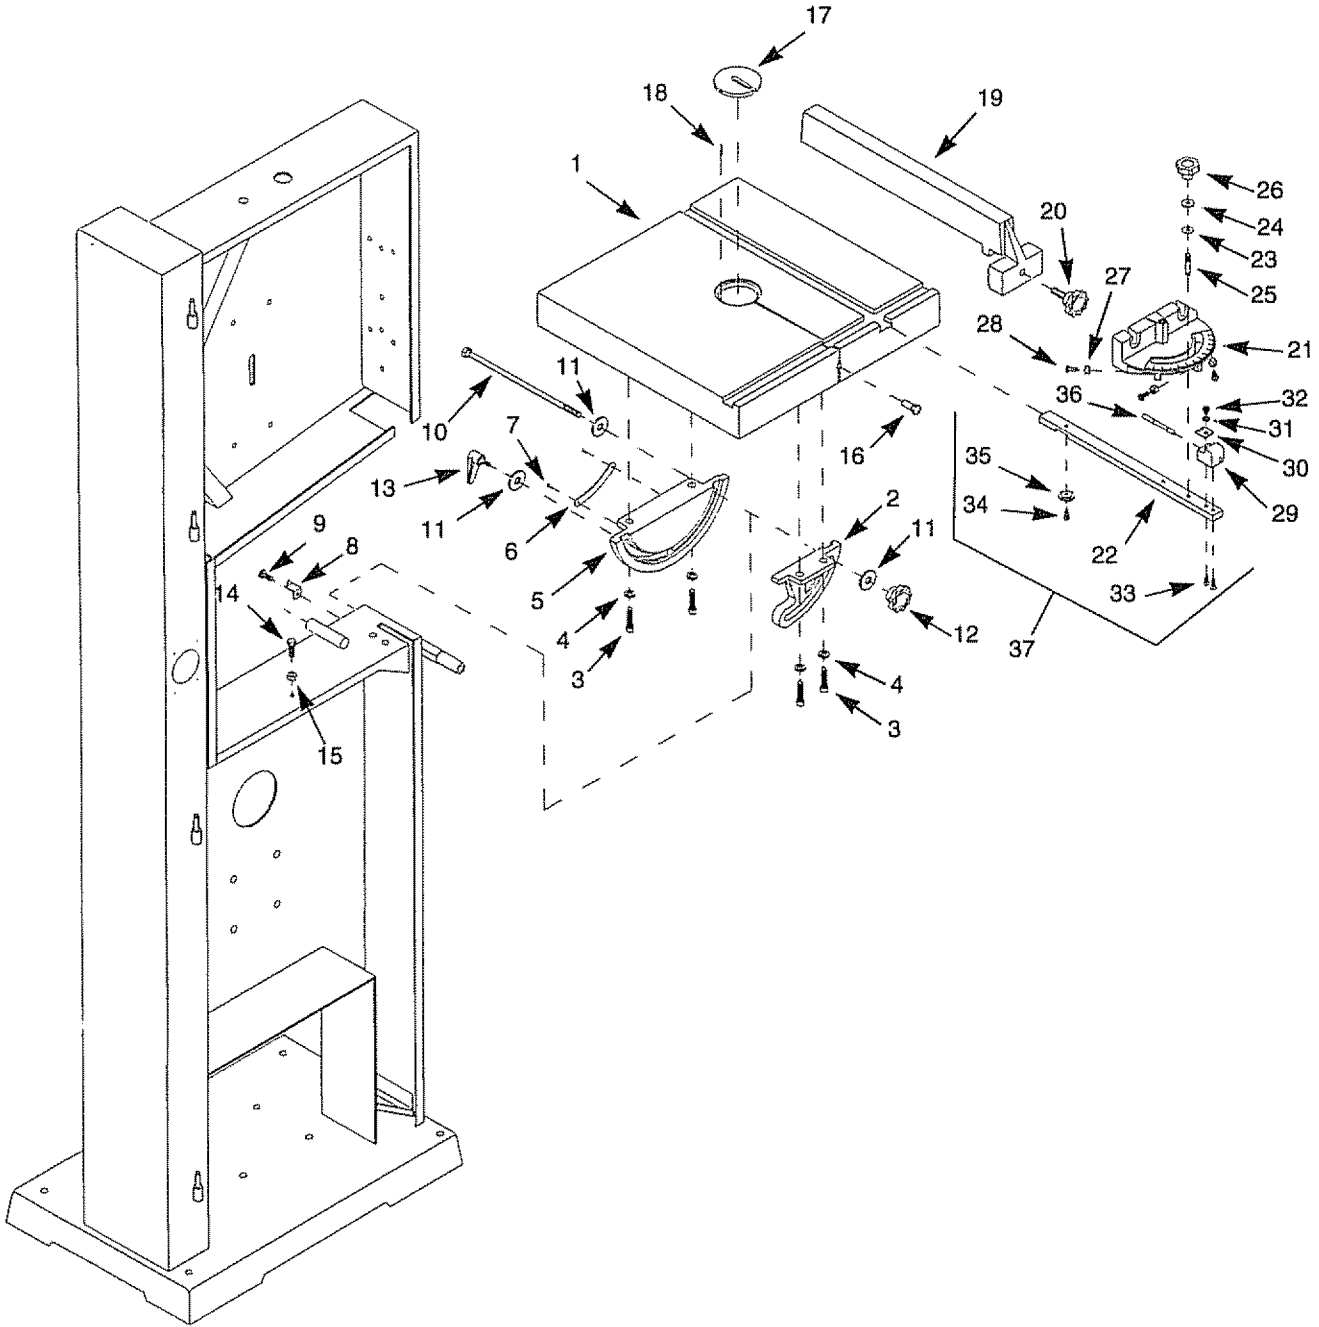


REPLACEMENT PARTS LIST FOR TABLE

KEY NO.	PART NO.	DESCRIPTION	QTY.
1	8326.00	Table	1
2	3660.00	Front Trunnion	1
3	1822.00	8-1.25 x 20mm Socket Head Bolt	4
4	STD852008	8mm Lock Washer*	4
5	8327.00	Back Trunnion	1
6	8328.00	Trunnion Scale	1
7	1286.00	Rivet	2
8	8329.00	Trunnion Indicator	1
9	0361.00	5-0.8 x 8mm Pan Head Screw	1
10	9574.00	Trunnion Rod with Acorn Nut	1
11	STD851008	8mm Flat Washer*	3
12	3659.00	Knob (Internal Threads)	1
13	8330.00	Knob (External Threads)	1
14	STD835025	8-1.25 x 25mm Hex Head Bolt*	1
15	STD840812	8-1.25 Hex Nut*	1
16	8331.00	Table Stud	1
17	0210.00	Table Insert	1
18	6396.00	3 x 12mm Spring Pin	1
19	5351.00	Rip Fence	1
20	0010.00	Knob (External Threads)	1
21	8251.00	Miter Gauge	1
22	8250.00	Miter Gauge Bar	1
23	1370.00	#10 Fiber Washer	1
24	STD551025	¼" Flat Washer*	3
25	8255.00	Threaded Pin	1
26	8252.00	Knob (Internal Threads)	1
27	STD541010	#10-24 Hex Nut*	3
28	STD511007	#10-24 x ¾" Pan Head Screw*	3
29	8253.00	Indicator	1
30	8254.00	Scale	1
31	STD551010	#10 Flat Washer*	1
32	STD511002	#10-24 x ¼" Pan Head Screw*	1
33	5991.00	#10-24 x ½" Flat Head Screw	2
34	1883.00	5-0.8 x 8mm Flat Head Screw	1
35	1093.00	Guide	1
36	8256.00	Indexing Pin	1
37	8257.00	Miter Gauge Assembly (Ref. Nos. 21 - 36)	1

* Standard hardware item available locally.

Model 351.243971

Figure 10 - Replacement Parts Illustration for Gear Box

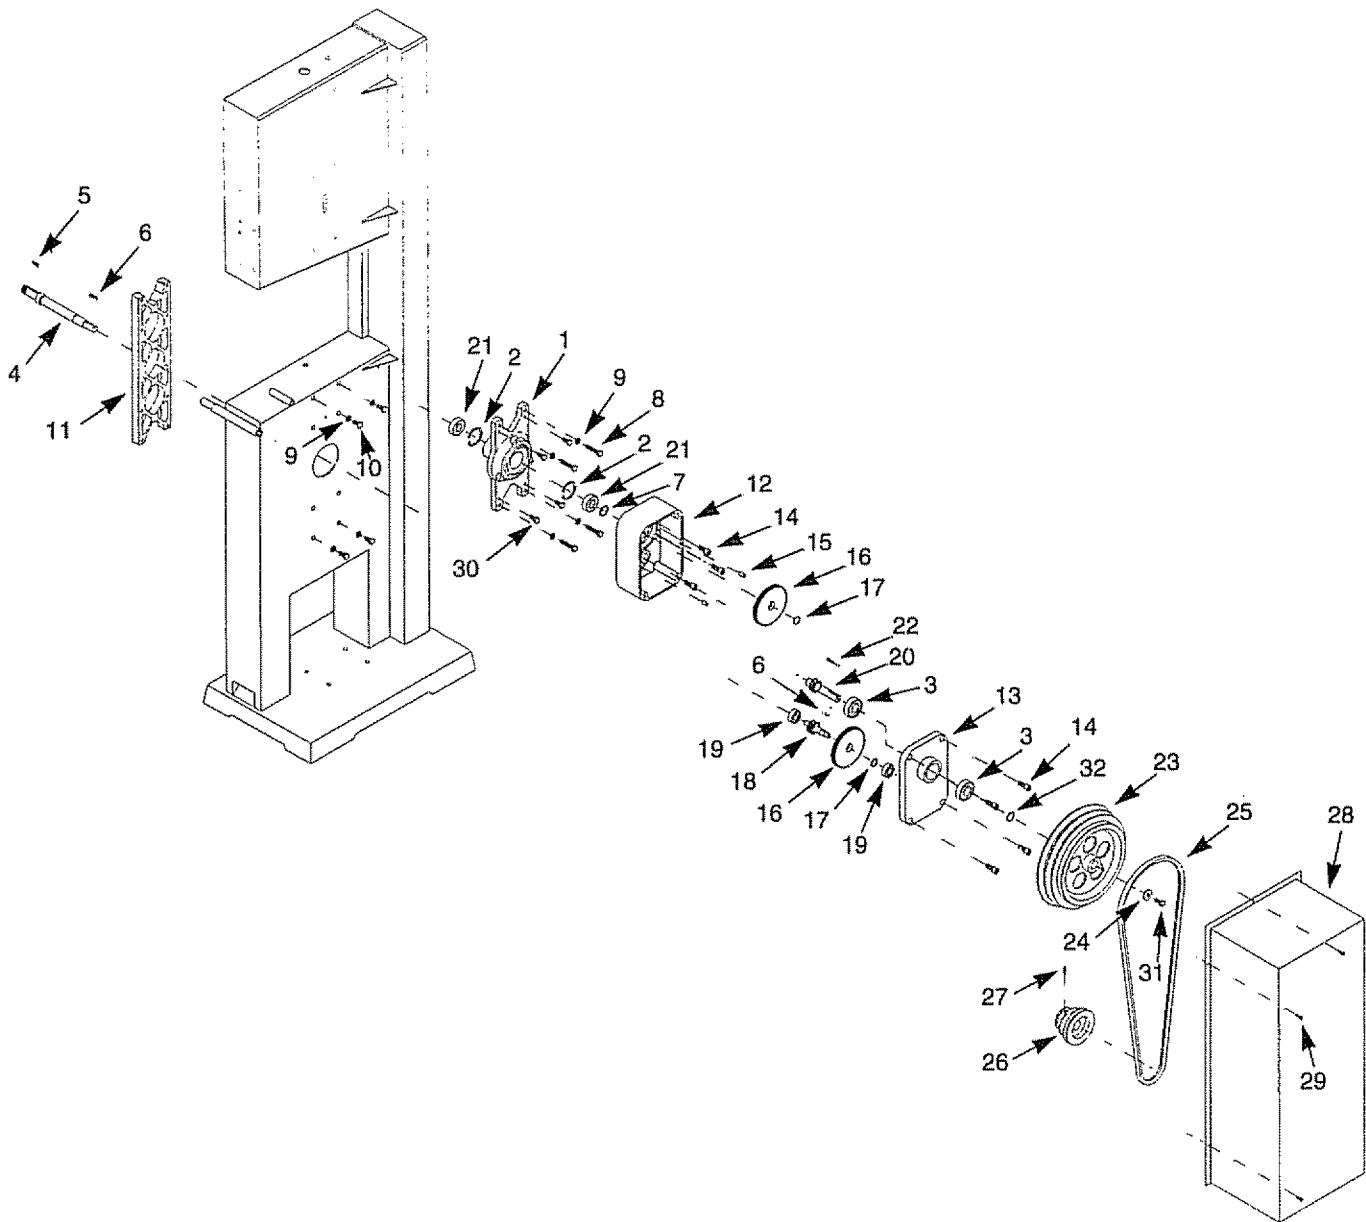


REPLACEMENT PARTS LIST FOR GEAR BOX

KEY NO.	PART NO.	DESCRIPTION	QTY.
1	8332.00	Shaft Support	1
2	7904.00	3BMI-42 Retaining Ring	2
3	8333.00	6004Z	2
4	8364.00	Wheel Drive Shaft	1
5	5889.00	7 x7 x 20mm Key	1
6	8661.00	7 x7 x 15mm Key	2
7	1900.00	3AMI-25 Retaining Ring	1
8	1369.00	8-1.25 x 30mm Hex Head Bolt	4
9	STD852008	8mm Lock Washer*	10
10	STD835020	8-1.25 x 20mm Hex Head Bolt*	6
11	3625.01	Lower Cabinet Support	1
12	8336.00	Gear Box	1
13	8337.00	Gear Box Cover	1
14	1822.00	8-1.25 x 20mm Socket Head Bolt	7
15	8338.00	6 x 20mm Dowl Pin	2
16	9597.00	Gear	2
17	1861.00	3AMI-22 Retaining Ring	2
18	9596.00	Gear Shaft	1
19	STD315205	6200LL Bearing*	2
20	9595.00	Pulley Drive Shaft	1
21	8498.00	6905ZZ Bearing	2
22	8438.00	5 x5 x 30mm Key	1
23	8344.00	Idler Pulley	1
24	STD851010	10mm Flat Washer*	1
25	STD304520	V-Belt*	1
26	8345.00	Motor Pulley	1
27	0964.00	6-1.0 x 6mm Set Screw*	1
28	8487.00	Shroud	1
29	0361.00	5-0.8 x 8mm Pan Head Screw	4
30	STD835025	8-1.25 x 25mm Hex Head Bolt	4
31	1795.00	10-1.5 x 20mm Hex Head Bolt	1
32	0256.00	3AMI-20 Retaining Ring	1

* Standard hardware item available locally

For the repair or replacement parts you need
delivered directly to your home
Call 7 am - 7 pm, 7 days a week
1-800-366-PART
(1-800-366-7278)

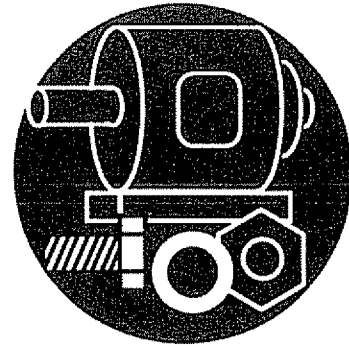

For in-home major brand repair service
Call 24 hours a day, 7 days a week
1-800-4-REPAIR
(1-800-473-7247)



For the location of a Sears Parts and
Repair Center in your area
Call 24 hours a day, 7 days a week
1-800-488-1222



When requesting service or ordering
parts, always provide the following
information:

- Product Type
- Model Number
- Part Number
- Part Description

SEARS
REPAIR SERVICES
America's Repair Specialists